




Typical Timber Frame Cons:  
 100 Brick External Leaf  
 60 Cavity  
 Breather Membrane  
 Dressed over D.P.C on  
 18 WBP Plywood with  
 100x175 Timber Frame Inner leaf with  
 100 Quilt Insulation  
 Vapour Barrier on  
 12.5 Internal Plasterboard

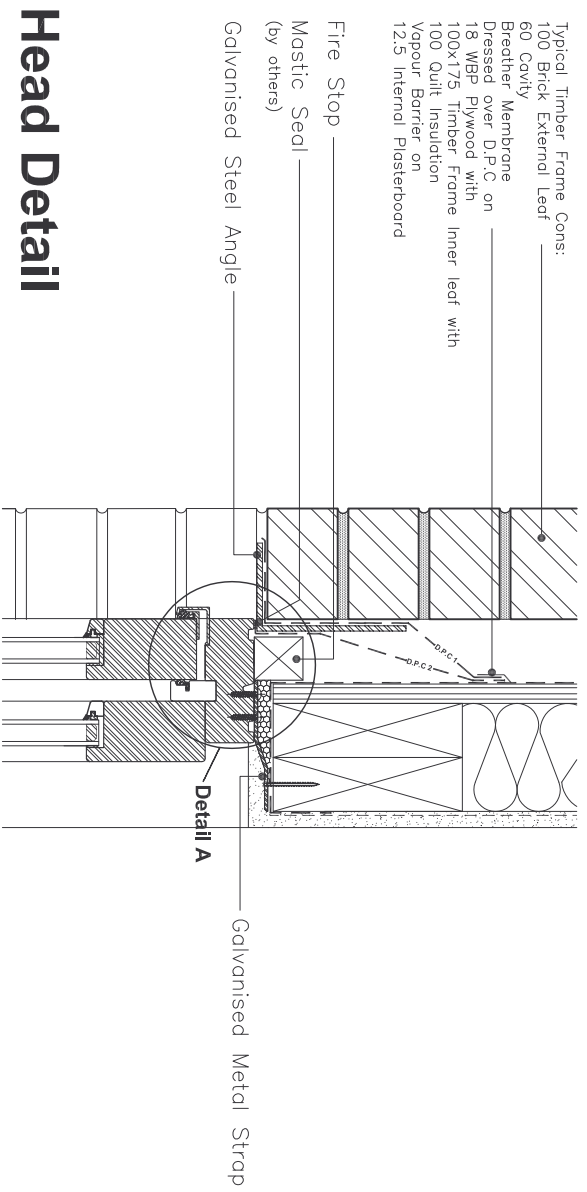


## Head Detail

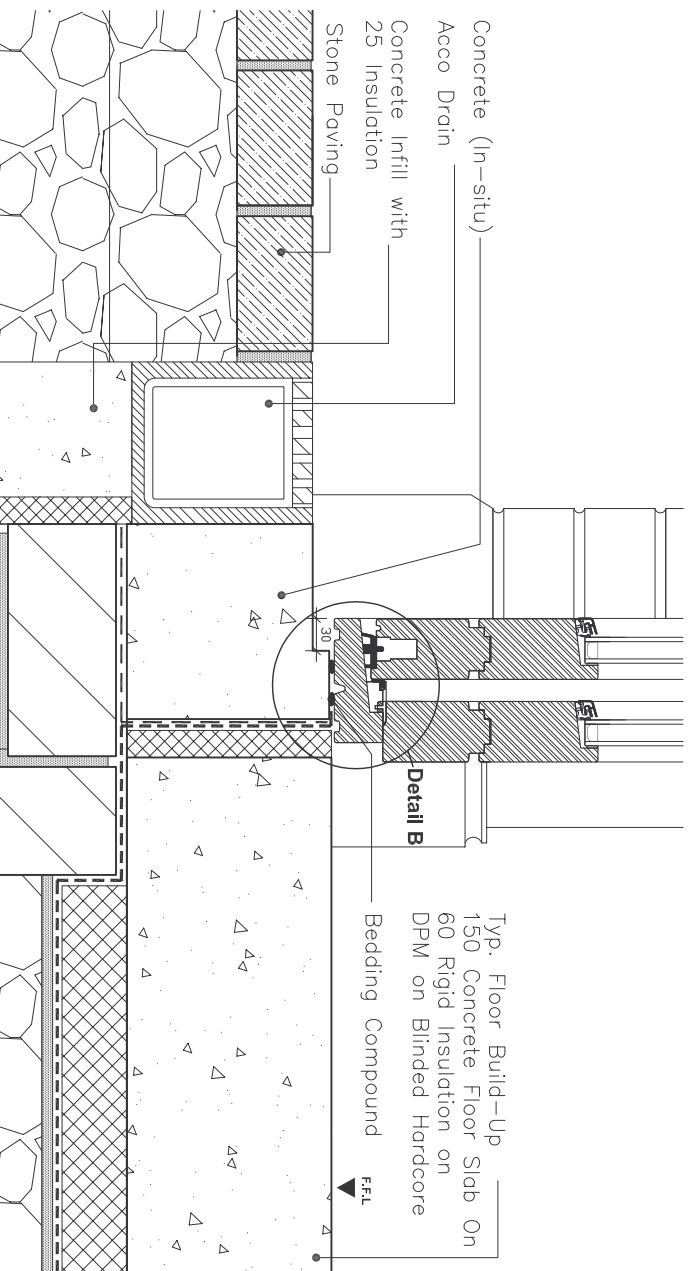

## Hardwood Threshold Sliding Door

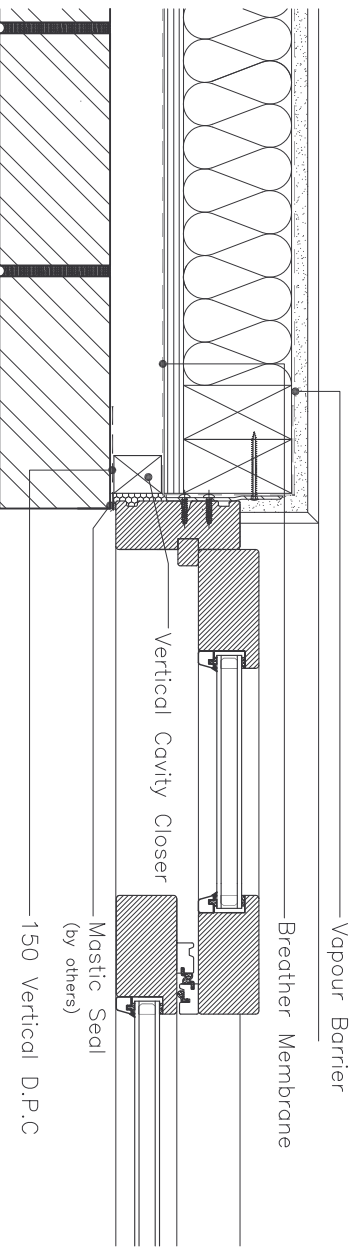


## Jamb Detail

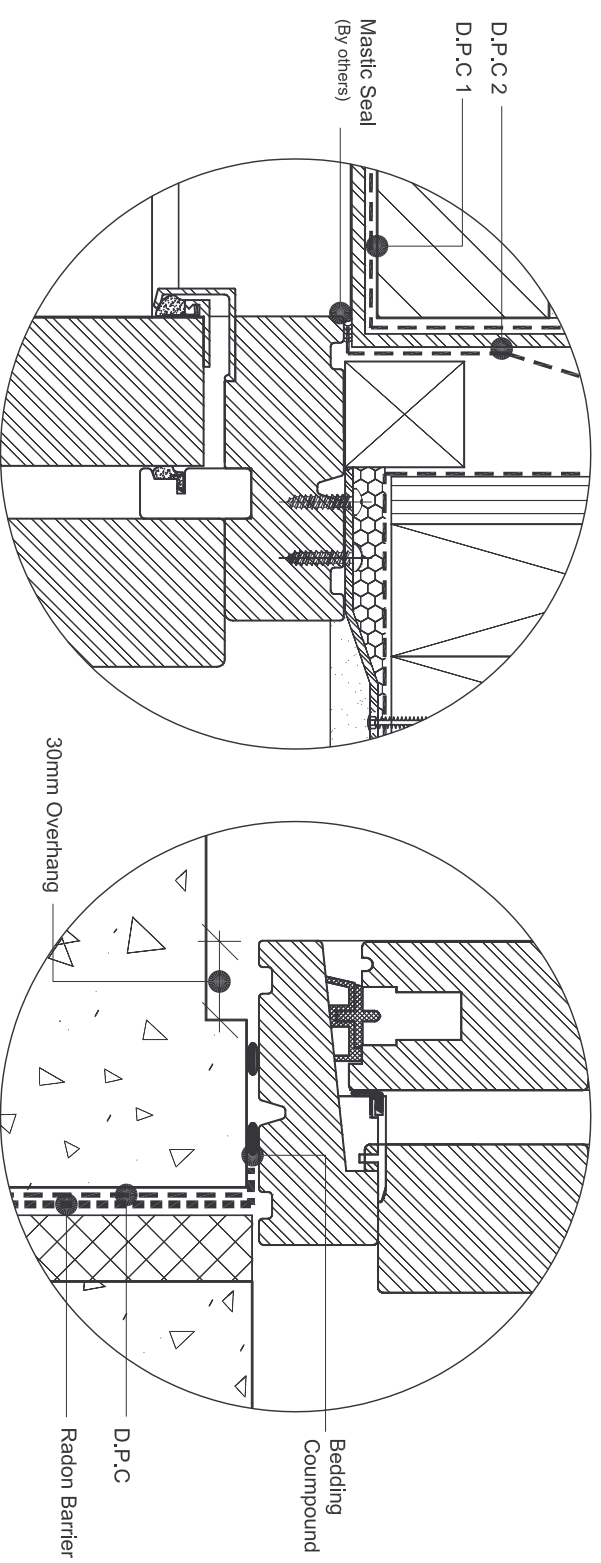

Detail A

Detail B

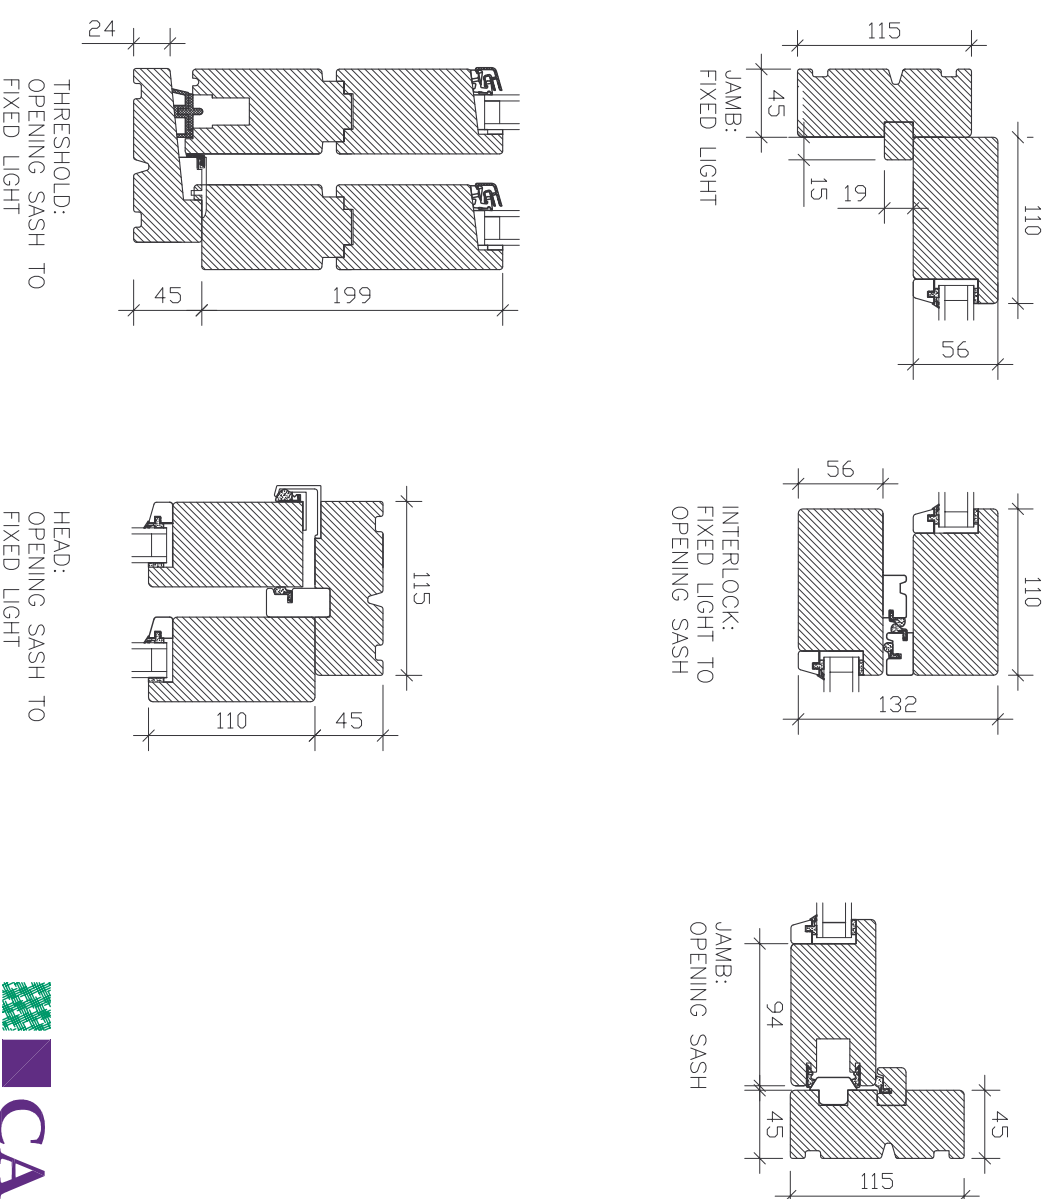

## Profile Sections



G1, Calmount Park, Ballymount, D12  
 TEL: 00 353 1 462 5777 FAX: 00 353 1 462 5737  
 WEB: www.carlson.ie EMAIL: info@carlson.ie

DETAIL 163: TIMBER FRAME BRICKWORK